

# Aftermarket Service Bulletin

BorgWarner  
Turbo Systems GmbH

Alte B40  
No. 1

D-67292  
Kirchheim-  
Bolanden

Telephone  
+49 (0) 6352 403 4831  
Fax  
+49 (0) 6352 403 4840  
E-mail  
cseibert@borgwarner.com

Contact Person  
Christian Seibert



Date : **08.08.2013**


Bulletin Number : **S08A2013**

## R2S™ CHARGING SYSTEM 1000 988 0036 FOR MERCEDES-BENZ SPRINTER

### IMPORTANT INFORMATION

Dear Distributor,

With bulletin M10A2012 we informed you that the R2S system 1000 988 0036 services the previous version 1000 970 0008. However, there is a significant geometrical difference between the two products:

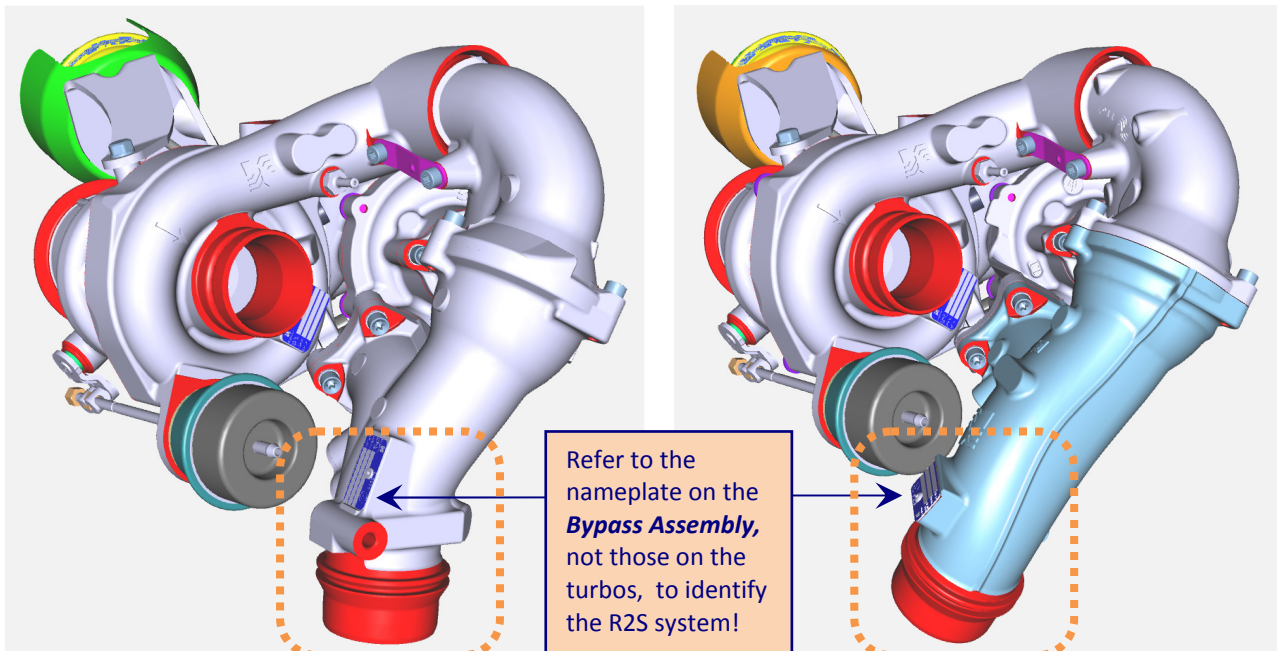

**1000 970 0008**  
A 651 090 0880  
A 651 090 2280  
A 651 090 4880  
A 651 090 4780  
A 651 090 5280

**1000 988 0036**  
A 651 090 6080

To fit 1000 988 0036 instead of 1000 970 0008 the following components are required as well:

Charge air pipe	A 906 528 5082 or -5182*
Coolant pipe	A 906 501 1482
Support	A 651 096 2940
Support	A 651 096 3040
Screw (3x)	N 910143 006001

\*Use -5182 if vehicle has optional equipment codes H08, N63 or HK4

The R2S system 1000 970 0008 was in production from September 2008 until 09 Dec 2010; it was fitted up to engine number 30468350. Vehicles built from 10 Dec 2010 and engine number 30468351 onwards come with 1000 970 0036 fitted as original equipment.

We sincerely apologise for any inconvenience that may have been caused by not providing this information in the first place.

Yours faithfully

BorgWarner Turbo Systems GmbH  
Christian Seibert  
Engineering Manager IDS Europe